



C&K Industrial Services, Inc.
5617 E. Schaaf Rd.
Independence, Ohio 44131
216-642-0055

PACP Report with Pipe Run and Incident Snapshots

Surveyed by: Mike Head	Certificate number: 123456	Owner: C & K Industrial Service, Inc	Customer:	Drainage area:	P/O number:	Sheet number:
Pipe segment ref.: SNG-4-4	Start date/time: 20220916 10:47	Street: BIG INDIAN DR	City: MASSILLON			
Location details:		Upstream MH No: 1973 SR21	Rim to invert:	Grade to invert:	Rim to grade:	
Pipe use: SS	Direction: D	Flow control:	Downstream MH No: 2183 SR21	Rim to invert:	Grade to invert:	Rim to grade:
Height: 72 in.	Width:	Shape: C	Material: RCP	Lining method:	Pipe joint length:	Total length: 499.200 ft.
Length surveyed: 499.200 ft.	Purpose:	Sewer category:				
Media label:	Pre-cleaning: N	Date cleaned:	Weather: 1	Location code:	Pressure value:	
Project name: CITY OF MASSILLON	Additional info:					


Grade	Structural:					O&M:					Overall:	
	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Pipe Rating	Pipe Rating Index
1	0	0	238	2V00	2.0	1	1	292	3R11	3.0	530	2.4
2	119	238				0	0					
3	0	0				97	291					
4	0	0				0	0					
5	0	0				0	0					

Observations


Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location		Rating	Image Ref.	Remarks
					1st	2nd			At/From	To			
0.0 ft.		AMH						☐	/			CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-AMH at 0.0 ft.JPG	1973 SR21
0.0 ft.		MWL					20	☐	/			CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-MWL at 0.0 ft.JPG	
5.7 ft.	00:01:26	DSF	S01				15	☐	5 / 7		3	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-DSF at 5.7 ft.JPG	
5.7 ft.	00:01:52	SSS	S02					☐	7 / 5		2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-SSS at 5.7 ft.JPG	
171.1 ft.	00:06:08	CL	S03					☐	12 /		2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-CL at 171.1 ft.JPG	
218.5 ft.	00:07:39	CL	F03					☐	12 /		2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-CL at 218.5 ft.JPG	
239.7 ft.	00:08:46	CL	S04					☐	12 /		2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-CL at 239.7 ft.JPG	

Observations

Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location At/From To		Rating	Image Ref.	Remarks
305.4 ft. 00:10:34		CL	F04		1st	2nd		☐	12	/	2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-CL at 305.4 ft.JPG	
488.5 ft. 00:14:44		DSF	F01				15	☐	5	/ 7	3	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-DSF at 488.5 ft.JPG	
488.5 ft. 00:14:59		LR					10	☐	/		1	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-LR at 488.5 ft.JPG	ENTERING MANHOLE
488.5 ft. 00:14:51		SSS	F02					☐	7	/ 5	2	CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-SSS at 488.5 ft.JPG	
499.2 ft. 00:16:26		AMH						☐	/			CITY OF MASSILLON-AMH '1973 SR21'-AMH '2183 SR21'-AMH at 499.2 ft.JPG	2183 SR21

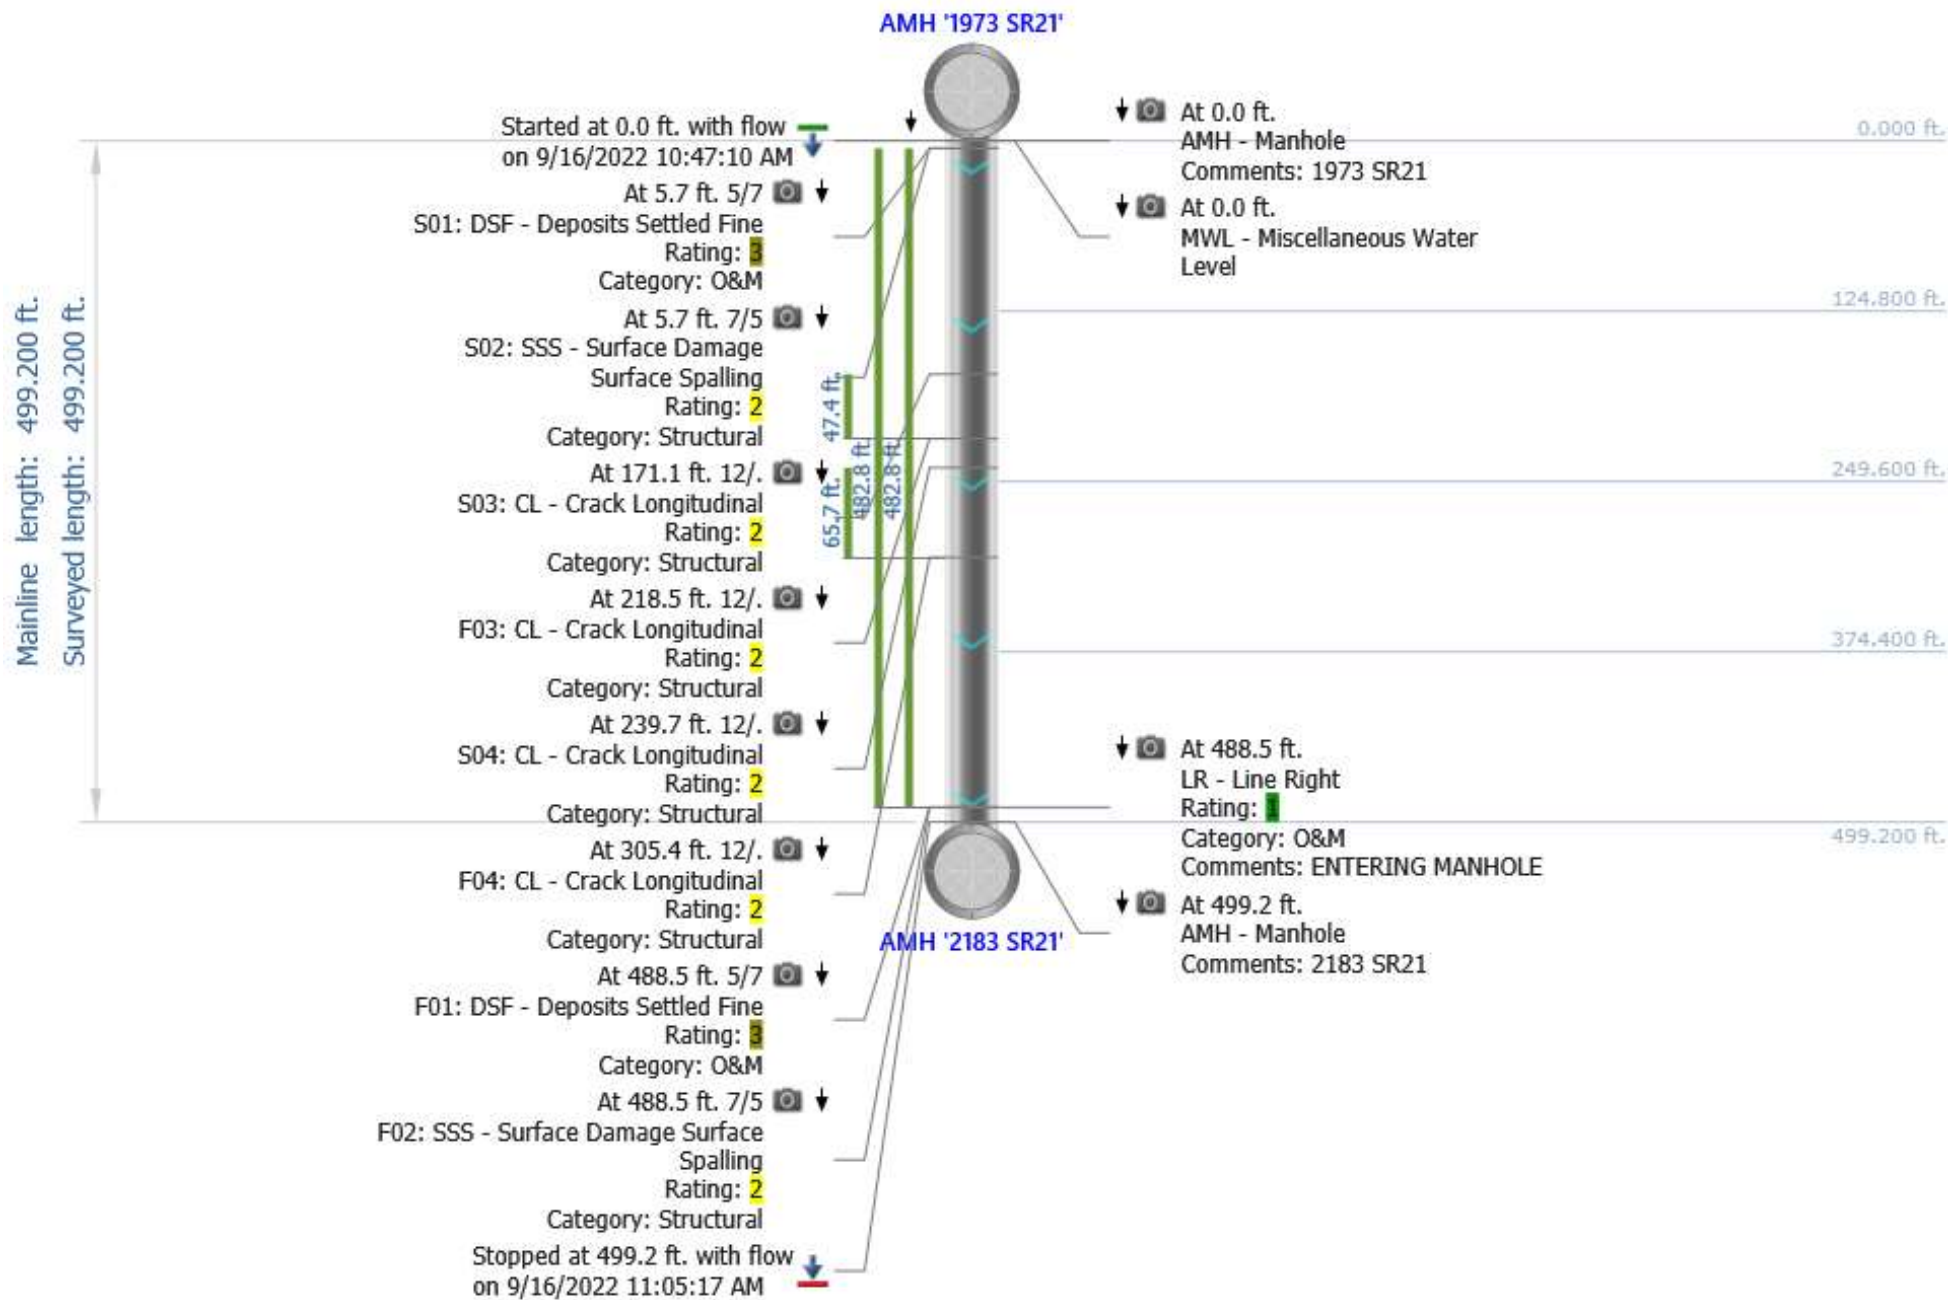

Photos

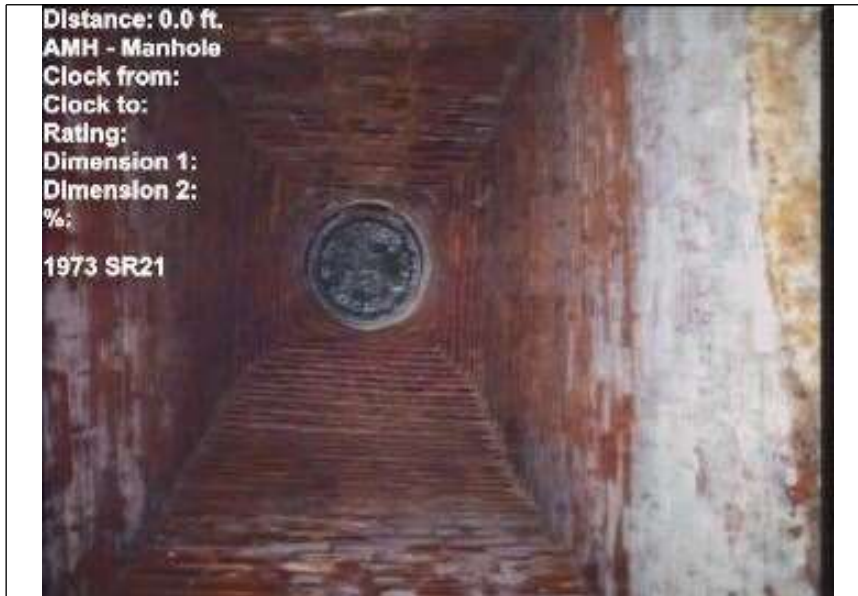

At: 0 ft. AMH - Manhole
Joint: No 1973 SR21



At: 0 ft. MWL - Miscellaneous Water Level
Joint: No 20 %



At: 5.7 ft. 5/7 DSF - Deposits Settled Fine
Joint: No 15 %



At: 5.7 ft. 7/5 SSS - Surface Damage Surface Spalling
Joint: No


Photos



At: 171.1 ft. 12/. CL - Crack Longitudinal
Joint: No



At: 239.7 ft. 12/. CL - Crack Longitudinal
Joint: No

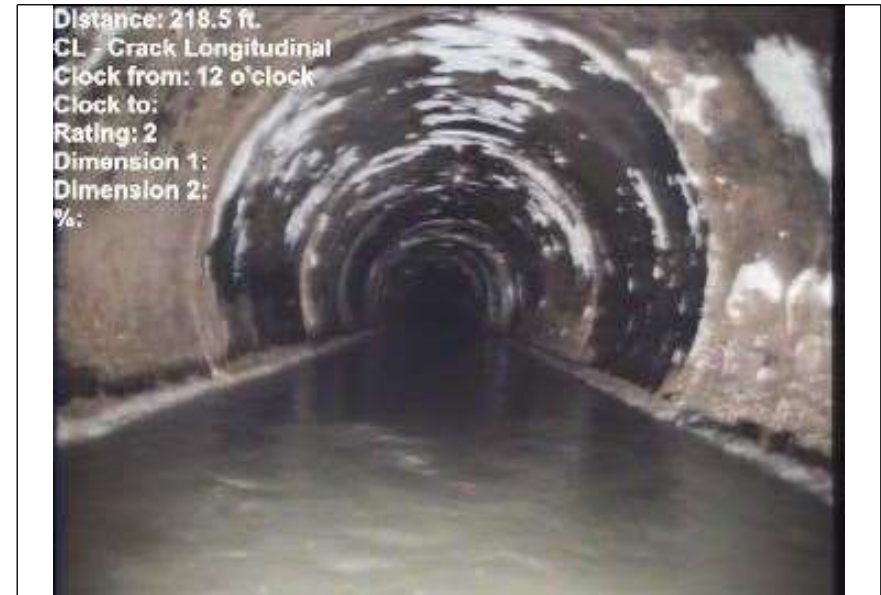

At: 218.5 ft. 12/. CL - Crack Longitudinal
Joint: No




At: 305.4 ft. 12/. CL - Crack Longitudinal
Joint: No

Photos



At: 488.5 ft. 5/7 DSF - Deposits Settled Fine

Joint: No 15 %

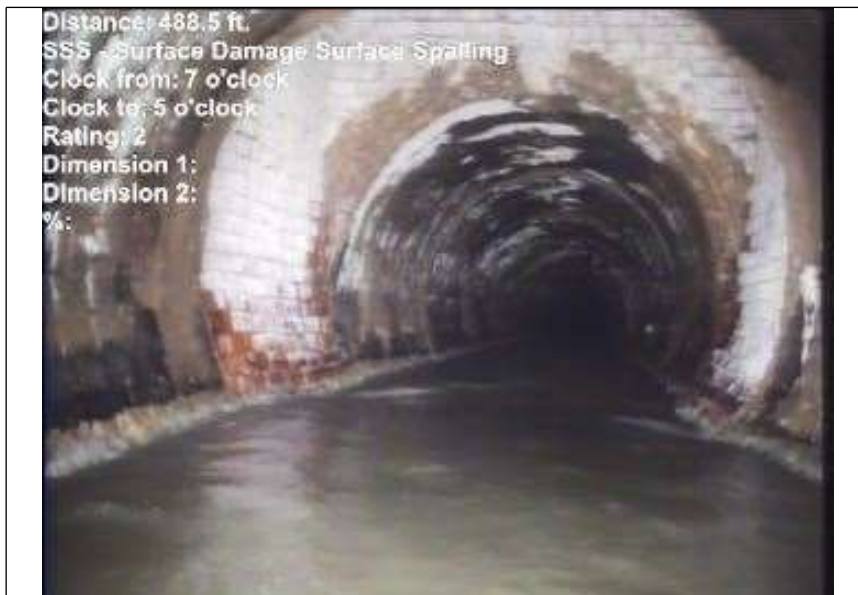

At: 488.5 ft. 7/5 SSS - Surface Damage Surface Spalling

Joint: No



At: 488.5 ft. LR - Line Right

Joint: No 10 % ENTERING MANHOLE



At: 499.2 ft. AMH - Manhole

Joint: No 2183 SR21