



C&K Industrial Services, Inc.
5617 E. Schaaf Rd.
Independence, Ohio 44131
216-642-0055

PACP Report with Pipe Run and Incident Snapshots

Surveyed by: Mike Head	Certificate number: 123456	Owner: C & K Industrial Service, Inc	Customer:	Drainage area:	P/O number:	Sheet number:
Pipe segment ref.: SNG-4-7	Start date/time: 20220915 14:56	Street: ERIE ST	City: MASSILLON			
Location details:		Upstream MH No: 1623 SR21	Rim to invert:	Grade to invert:	Rim to grade:	
Pipe use: SS	Direction: D	Flow control:	Downstream MH No: 1793 SR21	Rim to invert:	Grade to invert:	Rim to grade:
Height: 78 in.	Width:	Shape: C	Material: RCP	Lining method:	Pipe joint length:	Total length: 500.900 ft.
Length surveyed: 500.900 ft.	Purpose:	Sewer category:				
Media label:	Pre-cleaning: N	Date cleaned:	Weather: 1	Location code:	Pressure value:	
Project name: CITY OF MASSILLON	Additional info:					


Grade	Structural:					O&M:					Overall:	
	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Pipe Rating	Pipe Rating Index
1	0	0	12	2600	2.0	7	7	17	2517	1.4	29	1.6
2	6	12				5	10					
3	0	0				0	0					
4	0	0				0	0					
5	0	0				0	0					

Observations


Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location At/From To		Rating	Image Ref.	Remarks
0.0 ft.		AMH			1st	2nd		☐	/			CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-AMH at 0.0 ft.JPG	1623 SR21
0.0 ft.		MWL					20	☐	/			CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-MWL at 0.0 ft.JPG	
8.6 ft.	00:01:31	DSGV	S01				10	☐	5 / 7		2	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-DSGV at 8.6 ft.JPG	
32.9 ft.	00:02:34	DSGV	F01				10	☐	5 / 7		2	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-DSGV at 32.9 ft.JPG	
199.2 ft.	00:07:02	CL	S02					☐	12 /		2	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-CL at 199.2 ft.JPG	
227.0 ft.	00:07:59	CL	F02					☐	12 /		2	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-CL at 227.0 ft.JPG	
256.4 ft.	00:08:39	LD	S03				10	☐	/		1	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-LD at 256.4 ft.JPG	

Observations

Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location		Rating	Image Ref.	Remarks
					1st	2nd			At/From	To			
256.4 ft.	00:08:58	MWL					10	☐	/			CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-MWL at 256.4 ft.JPG	
289.2 ft.	00:10:21	LD	F03				10	☐	/		1	CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-LD at 289.2 ft.JPG	
289.2 ft.	00:09:57	MWL					20	☐	/			CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-MWL at 289.2 ft.JPG	
500.9 ft.	00:18:40	AMH						☐	/			CITY OF MASSILLON-AMH '1623 SR21'-AMH '1793 SR21'-AMH at 500.9 ft.JPG	1793 SR21

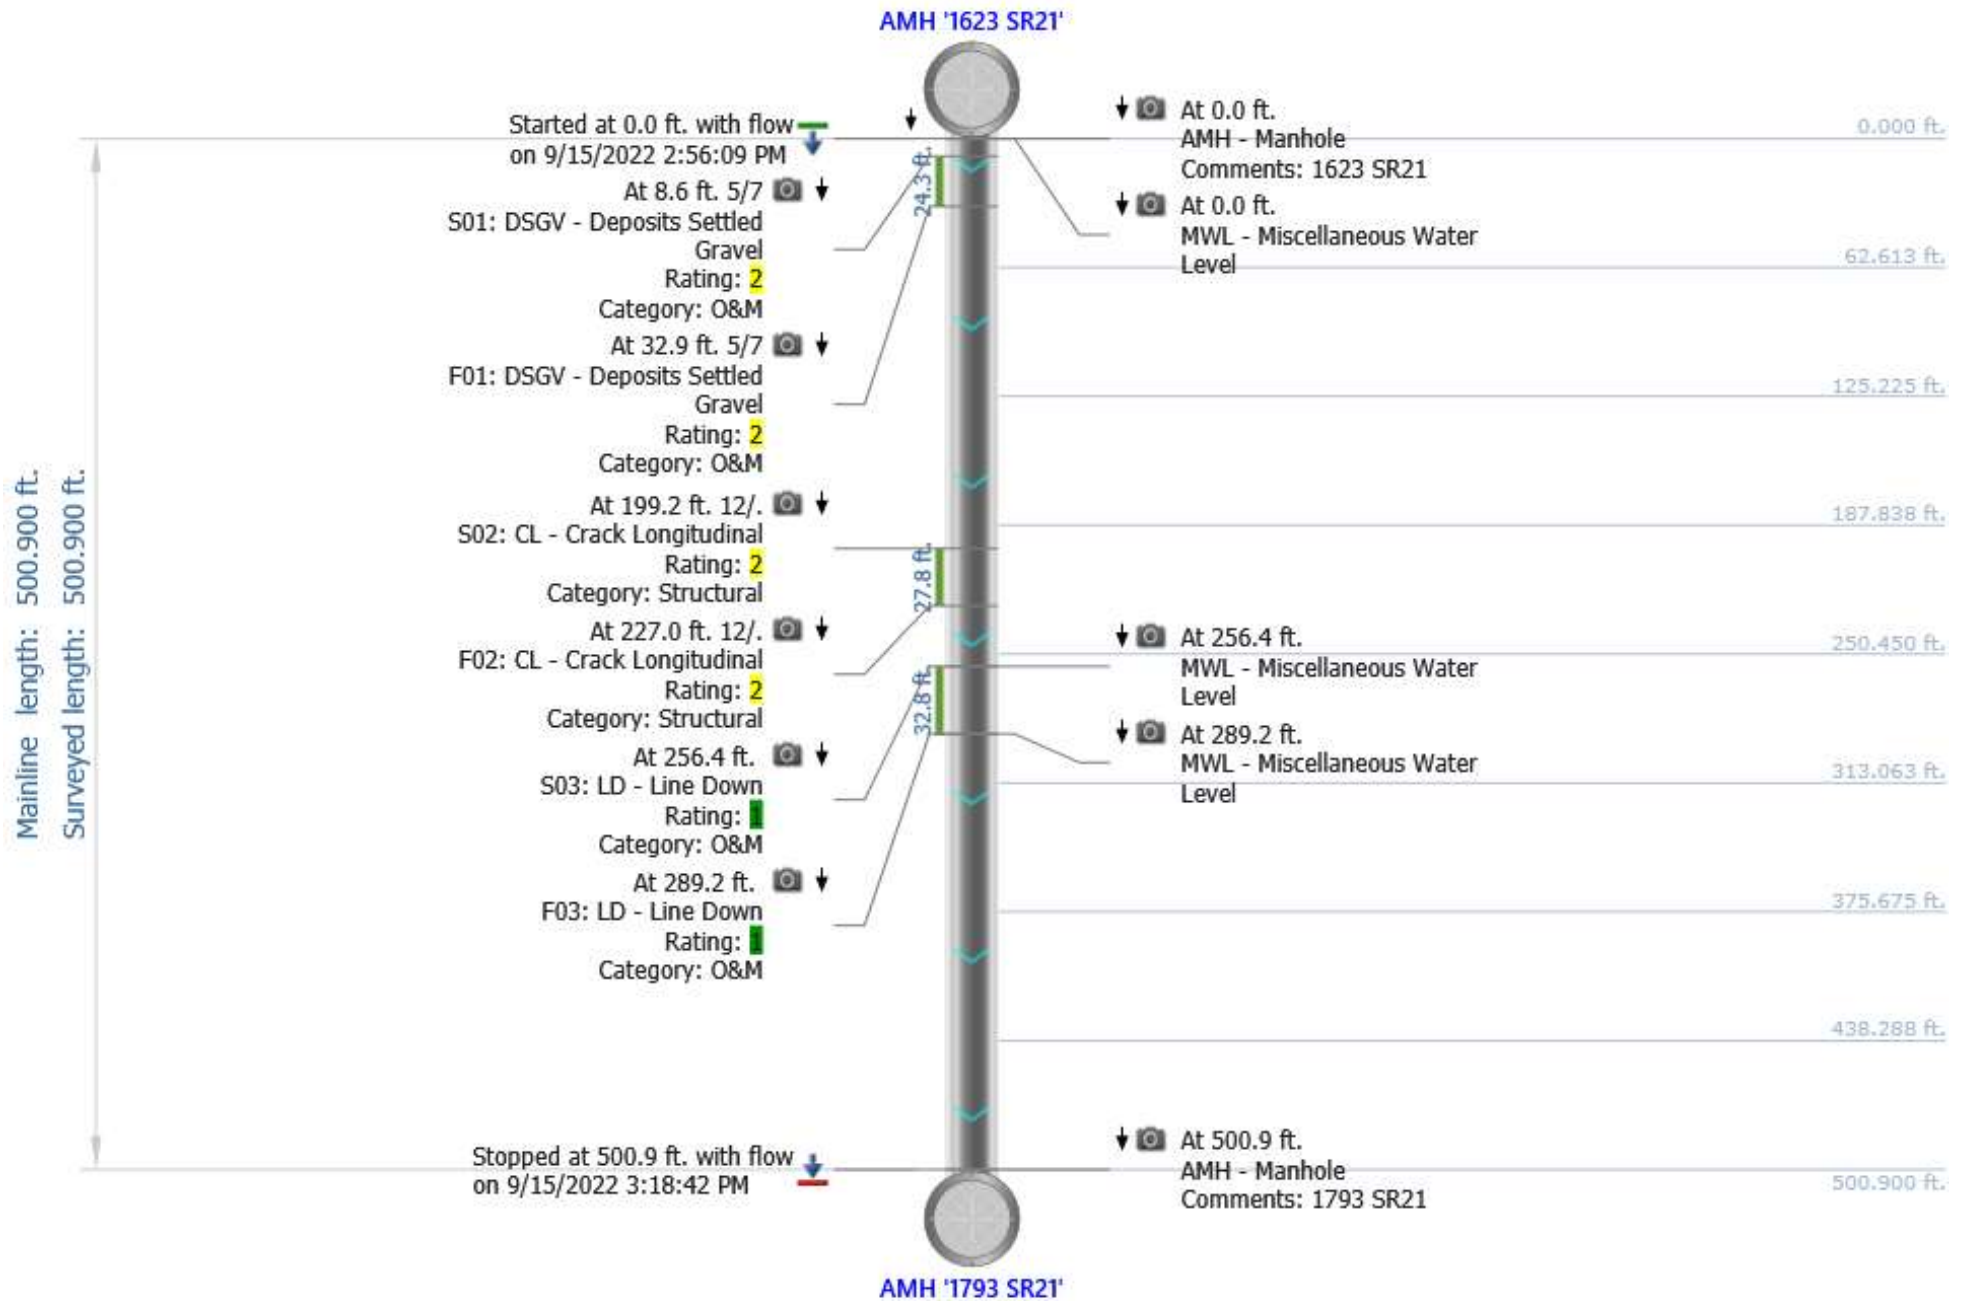

Photos

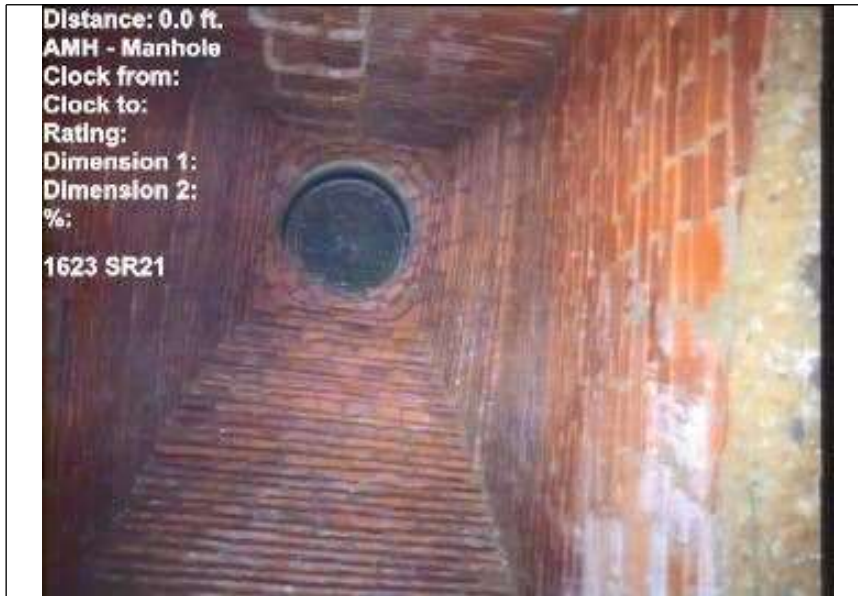

At: 0 ft. AMH - Manhole
 Joint: No 1623 SR21



At: 0 ft. MWL - Miscellaneous Water Level
 Joint: No 20 %



At: 8.6 ft. 5/7 DSGV - Deposits Settled Gravel
 Joint: No 10 %



At: 32.9 ft. 5/7 DSGV - Deposits Settled Gravel
 Joint: No 10 %

Photos



At: 199.2 ft. 12/. CL - Crack Longitudinal
Joint: No



At: 227 ft. 12/. CL - Crack Longitudinal
Joint: No



At: 256.4 ft. LD - Line Down
Joint: No 10 %



At: 256.4 ft. MWL - Miscellaneous Water Level
Joint: No 10 %


Photos



At: 289.2 ft. LD - Line Down
Joint: No 10 %



At: 289.2 ft. MWL - Miscellaneous Water Level
Joint: No 20 %

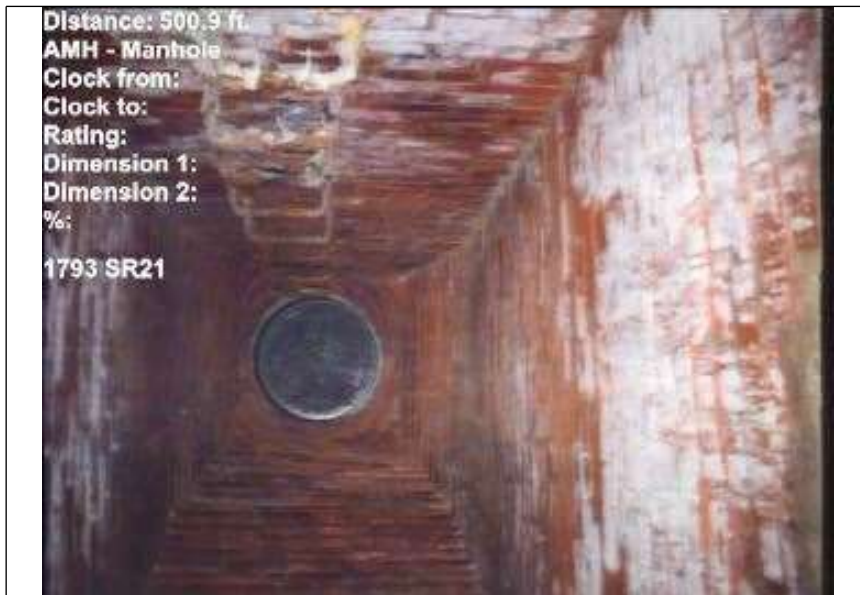

At: 500.9 ft. AMH - Manhole
Joint: No 1793 SR21