



C&K Industrial Services, Inc.
5617 E. Schaaf Rd.
Independence, Ohio 44131
216-642-0055

PACP Report with Pipe Run and Incident Snapshots

Surveyed by: Mike Head	Certificate number: 123456	Owner: C & K Industrial Service, Inc	Customer:	Drainage area:	P/O number:	Sheet number:
Pipe segment ref.: SNG-4-9	Start date/time: 20220915 14:20	Street: ERIE ST	City: MASSILLON			
Location details:	Upstream MH No: 1415 SR21	Rim to invert:	Grade to invert:	Rim to grade:		
Pipe use: SS	Direction: D	Flow control:	Downstream MH No: 1503 SR21	Rim to invert:	Grade to invert:	Rim to grade:
Height: 78 in.	Width:	Shape: C	Material: RCP	Lining method:	Pipe joint length:	Total length: 485.600 ft.
Length surveyed: 485.600 ft.	Purpose:	Sewer category:	Media label:	Pre-cleaning: N	Date cleaned:	Weather: 1
Location code:	Pressure value:	Project name: CITY OF MASSILLON	Additional info:			


Grade	Structural:					O&M:					Overall:	
	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Amount of Defects	Segment Grade	Pipe Rating	Quick Rating	Pipe Rating Index	Pipe Rating	Pipe Rating Index
1	46	46	46	1H00	1.0	0	0	166	3I22	3.0	212	2.1
2	0	0				2	4					
3	0	0				54	162					
4	0	0				0	0					
5	0	0				0	0					

Observations

Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location		Rating	Image Ref.	Remarks
					1st	2nd			At/From	To			
0.0 ft.		AMH						☐	/			CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-AMH at 0.0 ft.JPG	1415 SR21
0.0 ft.		MWL					20	☐	/			CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-MWL at 0.0 ft.JPG	
13.3 ft.	00:01:10	DSF	S01				15	☐	5 / 7		3	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-DSF at 13.3 ft.JPG	
44.1 ft.	00:02:16	SSC	S02					☐	7 / 5		1	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-SSC at 44.1 ft.JPG	
273.0 ft.	00:06:20	SSC	F02					☐	7 / 5		1	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-SSC at 273.0 ft.JPG	
282.4 ft.	00:06:30	DSF	F01				15	☐	5 / 7		3	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-DSF at 282.4 ft.JPG	
354.9 ft.	00:08:03	DSF					10	☐	7 / 5		2	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-DSF at 354.9 ft.JPG	

Observations

Distance	Video Ref.	PACP Code	Continuous	S/M/L	Value Inches (mm)		%	Joint	Circumferential Location At/From To		Rating	Image Ref.	Remarks
					1st	2nd							
484.4 ft.	00:11:16	LR					20	☐	/		2	CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-LR at 484.4 ft.JPG	
485.6 ft.	00:12:19	AMH						☐	/			CITY OF MASSILLON-AMH '1415 SR21'-AMH '1503 SR21'-AMH at 485.6 ft.JPG	1503 SR21

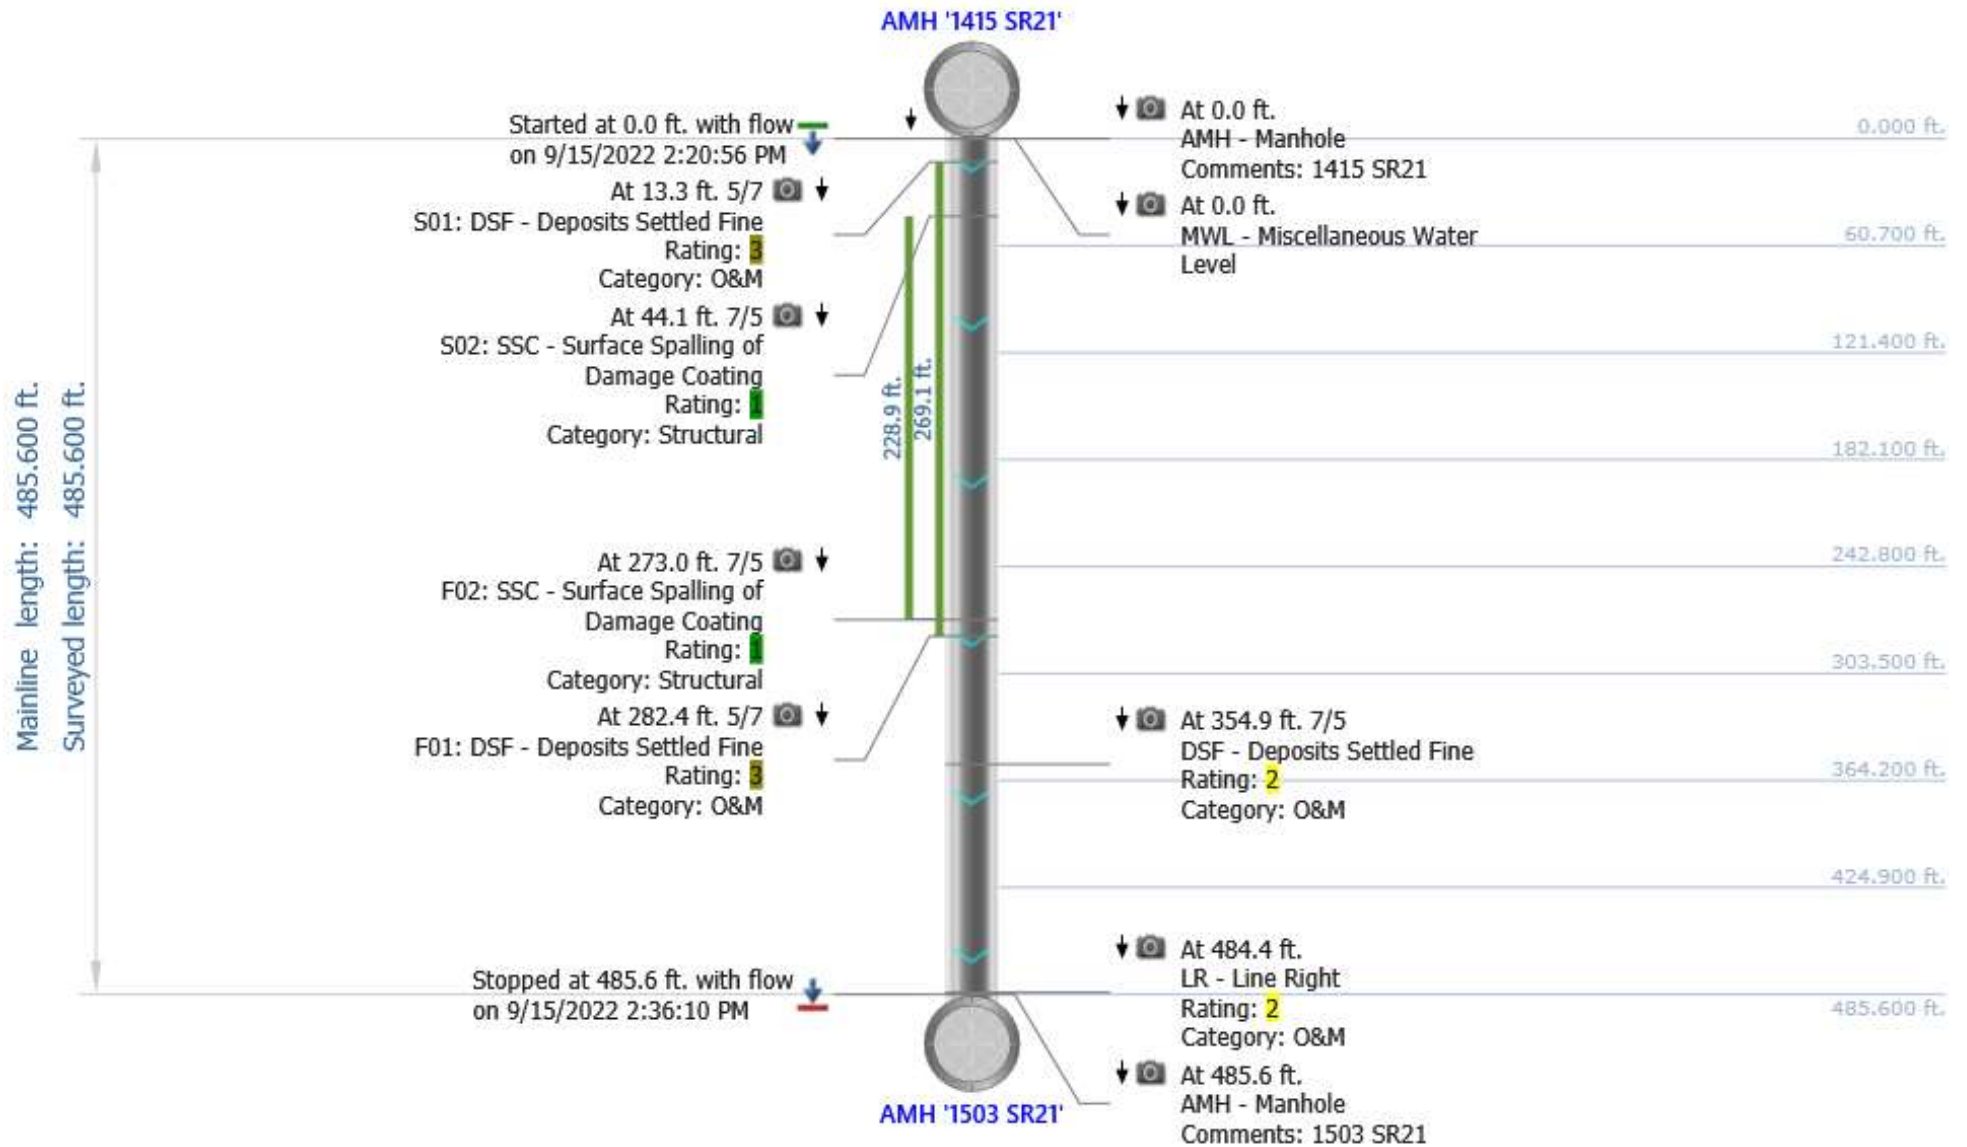

Photos




At: 0 ft. AMH - Manhole
Joint: No 1415 SR21



At: 0 ft. MWL - Miscellaneous Water Level
Joint: No 20 %



At: 13.3 ft. 5/7 DSF - Deposits Settled Fine
Joint: No 15 %

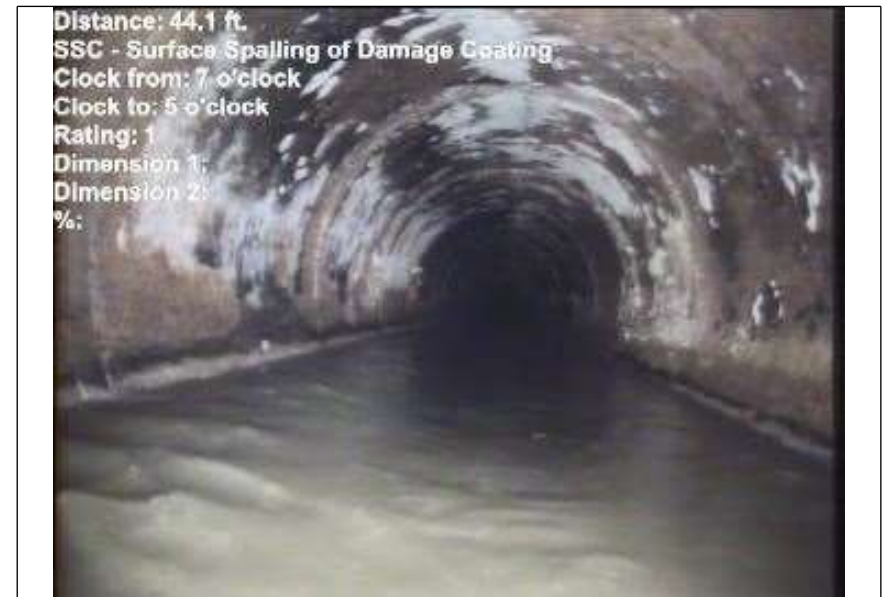

At: 44.1 ft. 7/5 SSC - Surface Spalling of Damage Coating
Joint: No

Photos



At: 273 ft. 7/5 SSC - Surface Spalling of Damage Coating
Joint: No



At: 282.4 ft. 5/7 DSF - Deposits Settled Fine
Joint: No 15 %




At: 354.9 ft. 7/5 DSF - Deposits Settled Fine
Joint: No 10 %



At: 484.4 ft. LR - Line Right
Joint: No 20 %

Photos

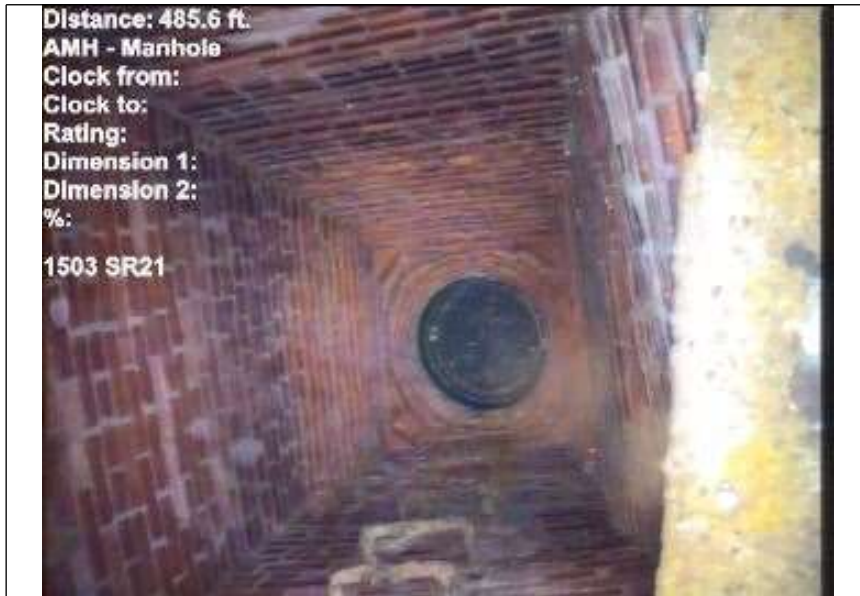

At: 485.6 ft. AMH - Manhole
Joint: No 1503 SR21