

Checked by: _____
Drawn by: _____

(UTILITY)

LINCOLN WAY EAST - 100' R/W

ALL WORK PERFORMED WITHIN THE RIGHT-OF-WAY OF LINCOLN WAY EAST SHALL BE COMPLETED IN STRICT ACCORDANCE WITH THE CITY OF MASSILLON STANDARDS. NO WORK SHALL BE PERFORMED WITHIN THE RIGHT OF WAY OF LINCOLN WAY EAST WITHOUT A CITY INSPECTOR PRESENT. REPAIR PAVEMENT PER CITY STANDARDS.

Issued / Revised		
No.	Date	Description
1	8-9-17	ISSUED FOR BIDDING & PERMIT
2	8-29-17	ADDENDUM NO. 3
3	6-30-18	ADD DOWNSPOUT @ N.E. CORNER OF BLDG
4	11-19-18	ADD RAMP IN SIDEWALK FRONT MUSEUM, ADD HC CURB RAMP, AND CATCH BASIN
5	11-20-18	ARTS GARDEN


GENERAL NOTES

- REFER TO BOUNDARY & TOPOGRAPHIC SURVEY COMPLETED BY DEIBEL SURVEYING, INC. FOR ALL TOPOGRAPHIC AND BOUNDARY INFORMATION INCLUDING OVERHEAD/UNDERGROUND UTILITIES.
- OVERHEAD UTILITY LINES SHOWN ONLY ON TOPOGRAPHIC & BOUNDARY SURVEY PLAN.



Civil & Construction Consultants

1225 North Main Street • Suite A • North Canton, OH 44720
PH: 330-966-1776 • FAX: 330-966-7911 • C: 330-495-3343
mjhettler@hettlerengineering.com

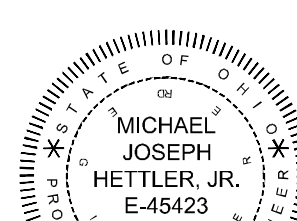

Michael Joseph Hettler, Jr.
8/21/2017

Massillon Museum Expansion + Renovation

121 Lincoln Way
Massillon, OH 44646

Project No. 25-16085-00




The Hanna Building
1422 Euclid Avenue, Suite 300
Cleveland, Ohio 44115-1407

T: 216.522.1350
www.DLRgroup.com

UTILITY PLAN

THE CONTRACTOR SHALL INSTALL 5 LF± OF 12" STORM SEWER BETWEEN NEW CATCH BASIN #1 AND THE EXISTING ROUND BASIN JUST TO THE SOUTH. IF THERE IS CLEARANCE WITH THE EXISTING DUCT BANK, IF IT IS NOT FEASIBLE TO INSTALL 12" STORM DESCRIBED ABOVE THEN CONTRACTOR SHALL CONNECT NEW CATCH BASIN #1 TO EXISTING 8" VCP USING PVC PIPE & FENCO COUPLING PER CITY OF MASSILLON REQUIREMENTS. RECONNECT 8" PVC DNP STORM FROM IN FRONT OF MUSEUM INTO CATCH BASIN #1.

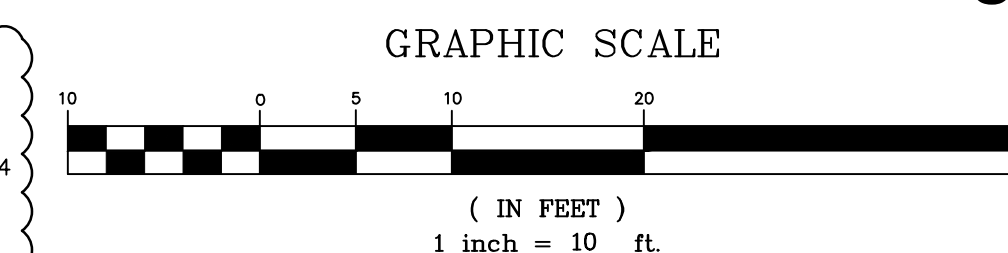

DATE: AUGUST 2017

C-104

Z:\Land Projects\17-1295\AUTOCAD\2018 revisions\MASSILLON MUSEUM - BASE3.dwg