


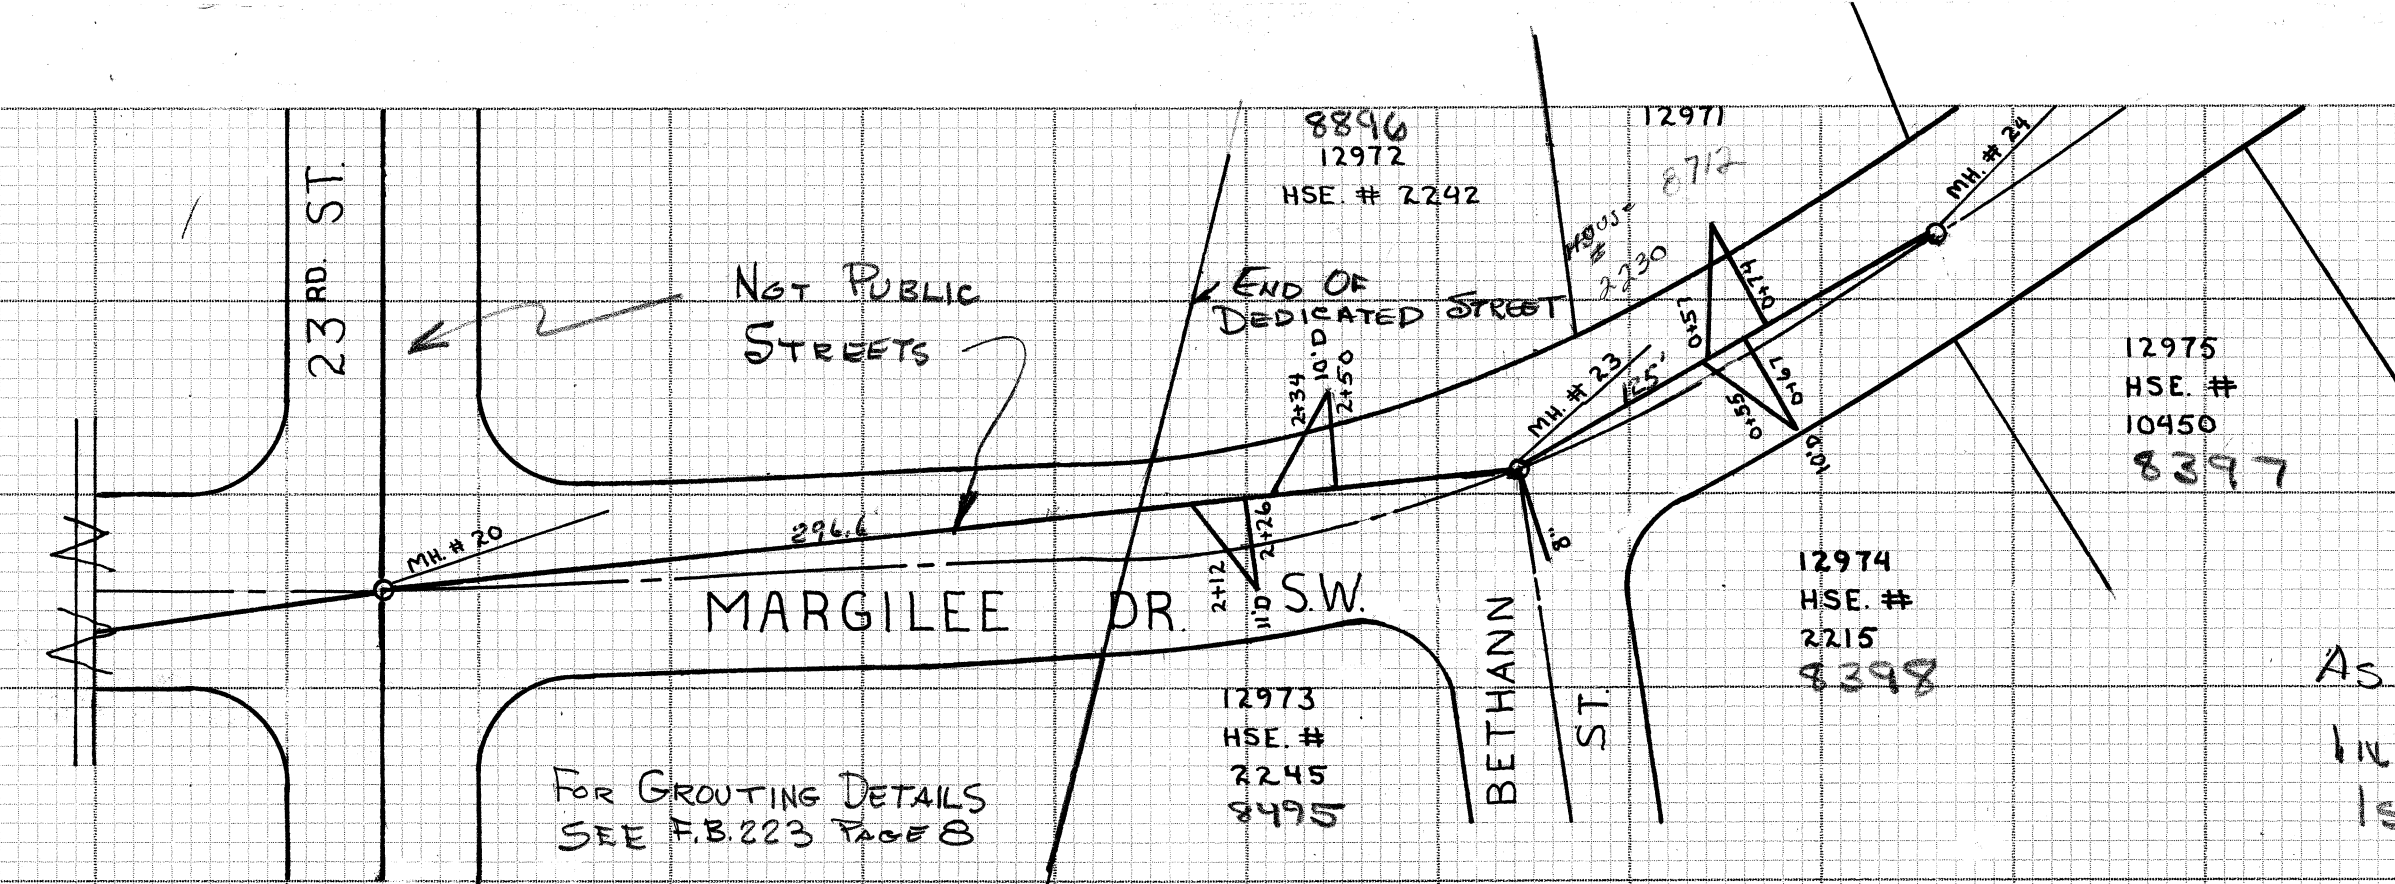

FOR GROUTING DETAILS
SEE F.B. 223 PAGE 8

AS OF OCT. 26, 1982
INSPECTOR'S SEWER BOOK 230
IS MISSING

DEC. 2 & 3RD, 1970
TELEVIZING SANITARY SEWERS BETWEEN MHS. 20 & 23
0+00 - Φ MARGILEE & 23RD - MH #20 DEC. 1970

0+05.50 - LEAK
0+92.50 - LEAK
1+02.50 - LEAK
1+22.50 - LEAK
2+69.50 - LEAK
2+96.50 Φ - MARGILEE & BETHANN - MH #23

THE FOLLOWING WERE GROUTED

- | | |
|---------|---------|
| 0+07.50 | 2+63.50 |
| 0+31.50 | 2+71.50 |
| 0+47.50 | |
| 0+51.50 | |
| 0+63.50 | |
| 0+67.50 | |
| 0+91.50 | |
| 1+15.50 | |
| 1+19.50 | |
| 1+31.50 | |
| 1+51.50 | |
| 1+55.50 | |
| 1+71.50 | |
| 2+33.50 | |

AFTER GROUTING
THE SUMPS WERE
OBSERVED
0+21.50 TO 0+34.50 - 1/2" WATER
0+74.50 TO 0+85.50 - 1/2" WATER
1+06.50 TO 1+28.50 - 1" WATER
1+44.50 TO 1+49.50 - 1" WATER

